



ALC Rooftop Sensor System

by Timothy Gregory

Approved for public release; distribution is unlimited.

NOTICES

Disclaimers

The findings in this report are not to be construed as an official Department of the Army position unless so designated by other authorized documents.

Citation of manufacturer's or trade names does not constitute an official endorsement or approval of the use thereof.

Destroy this report when it is no longer needed. Do not return it to the originator.



ALC Rooftop Sensor System

by Timothy Gregory

Computational and Information Sciences Directorate, ARL

REPORT DOCUMENTATION PAGE					Form Approved OMB No. 0704-0188
data needed, and comple burden, to Department o Respondents should be a valid OMB control numb	ting and reviewing the collect f Defense, Washington Heade ware that notwithstanding an per.	tion information. Send comments quarters Services, Directorate for	s regarding this burden esting Information Operations and on shall be subject to any pe	nate or any other aspect Reports (0704-0188).	astructions, searching existing data sources, gathering and maintaining the ct of this collection of information, including suggestions for reducing the 1215 Jefferson Davis Highway, Suite 1204, Arlington, VA 22202-4302. mply with a collection of information if it does not display a currently
1. REPORT DATE (DD-MM-YYYY)	2. REPORT TYPE			3. DATES COVERED (From - To)
October 2017		Technical Note			October 2015 – June 2017
4. TITLE AND SUB	TITLE				5a. CONTRACT NUMBER
ALC Rooftop	Sensor System				
-	·				5b. GRANT NUMBER
					5c. PROGRAM ELEMENT NUMBER
C AUTHOR(C)					E-L DDOUECT NUMBER
6. AUTHOR(S) Timothy Grego	ory				5d. PROJECT NUMBER
					5e. TASK NUMBER
					5f. WORK UNIT NUMBER
7. PERFORMING O	ΡΕΘΑΝΙΖΑΤΙΟΝ ΝΑΜΙ	E(S) AND ADDRESS(ES)			8. PERFORMING ORGANIZATION REPORT NUMBER
		-(0,72 7.22200(20)			
US Army Research Laboratory Computational and Information Sciences Directorate (ATTN: RDRL-CII-B) 2800 Powder Mill Road, Adelphi, MD 20783-1138					ARL-TN-0854
9. SPONSORING/MONITORING AGENCY NAME(S) AND ADDRESS(ES			SS(ES)		10. SPONSOR/MONITOR'S ACRONYM(S)
					11. SPONSOR/MONITOR'S REPORT NUMBER(S)
12. DISTRIBUTION	I/AVAILABILITY STATE	MENT			
Approved for p	public release; dis	tribution is unlimite	ed.		
13. SUPPLEMENTA	ARY NOTES				
14. ABSTRACT					
Laboratory Ce	nter (ALC) campı		ts of this sensor i	network are in	tal sensor network at the US Army Adelphi astalled on the roof of the ALC buildings.
15. SUBJECT TERM					
sensor network	x, rooftop sensor s	ystem, Adelphi Lab	oratory Center, A	ALC, weather	stations
16. SECURITY CLA	SSIFICATION OF:		17. LIMITATION	18. NUMBER	19a. NAME OF RESPONSIBLE PERSON
		,	OF ABSTRACT	OF PAGES	Timothy Gregory
a. REPORT	b. ABSTRACT	c. THIS PAGE		1.525	19b. TELEPHONE NUMBER (Include area code)

16

(301) 394-5604

UU

Unclassified

Unclassified

Unclassified

Contents

List	List of Figures		
1.	Intr	1	
2.	lmp	1	
	2.1	Larger Enclosures	2
	2.2	Network Cameras	3
	2.3	Device Server	4
	2.4	Weather Stations	4
	2.5	Ethernet Switches	5
	2.6	Cable Feed-Through	5
	2.7	Wireless Access Points	5
3.	Con	nection to the ALC Sensor Network	6
4.	Sub	scribing to Weather Station Data	8
5.	Sun	8	
List	of Sy	mbols, Abbreviations, and Acronyms	9
Dist	tribut	rion List	10

List of Figures

Fig. 1	Rooftop sensor layout	1
Fig. 2	Sensor box installation	2
Fig. 3	Interior view of the new sensor box	3
Fig. 4	Interior of original sensor box	3
Fig. 5	Camera installation	4
Fig. 6	Weather station	5
Fig. 7	Ubiquiti Rocket M900 with Yagi antenna on the NE corner of building 204	6
Fig. 8	Ubiquiti NanoStation Loco M900 on the SE corner of building 202	. 6
Fig. 9	Fiber optic patch panel	7
Fig. 10	Interior of fiber patch panel	. 7
Fig. 11	Java sample code to capture NMEA messages	. 8

1. Introduction

The original US Army Adelphi Laboratory Center (ALC) rooftop sensor system consisted of Sony Ball cameras mounted on the roof of the ALC buildings. As the Sony cameras failed, they were replaced with Axis network cameras.

As the US Army Research Laboratory's (ARL's) work in sensors grew, some additions and improvements were made to the rooftop components. This document describes the current rooftop system. Images are included in the document to help identify the equipment on the roof. Figure 1 shows the location of the equipment on the ALC buildings.

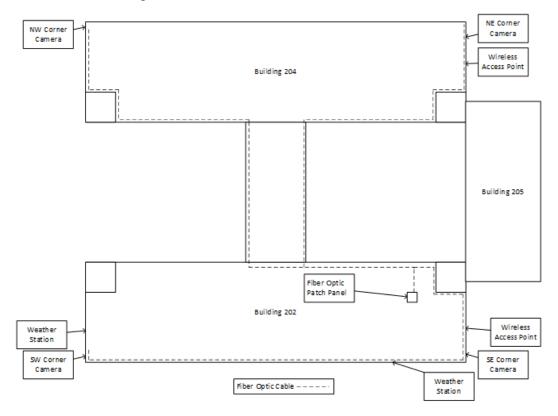


Fig. 1 Rooftop sensor layout

2. Improvements to the Rooftop Sensor System

In 2015, several improvements were made to the rooftop sensor system. Below is a summary of the improvements that were installed.

- Larger enclosures to house the current and future equipment.
- Device servers.

- Weather stations (temperature, wind, humidity, GPS) added.
- Network cameras.
- Wireless links to sensor sites on the ALC campus.
- Ethernet switch–8 port.
- Cable feed-through.
- Wireless access points.

2.1 Larger Enclosures

The original Pelican cases installed at the southeast (SE) and southwest (SW) corners have been replaced with larger Pelican cases. This will allow for additional equipment to be installed in the future. Figure 2 shows a new sensor box installed on the roof. Figure 3 shows the interior of the new sensor box. The new boxes are Pelican model #1610. The northeast (NE) and northwest (NW) corners still have the original Pelican case #1520. Figure 4 shows the view of the interior of the original sensor box.



Fig. 2 Sensor box installation



Fig. 3 Interior view of the new sensor box

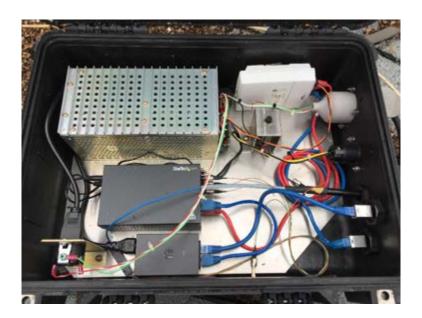


Fig. 4 Interior of original sensor box

2.2 Network Cameras

The cameras on the NE, SE, and SW corners of the building are AXIS P5534-E. The AXIS P5534-E provides HDTV 720p in compliance with the SMPTE 296M standard of 1280×720 pixel resolution, full frame rate, HDTV color fidelity, and a 16:9 format. The day and night camera can deliver multiple H.264 and Motion JPEG streams simultaneously. The NW corner of the building has an AXIS P5522-E. The Battlefield Information Processing Branch's cameras are mounted on aluminum C-channel as shown in Fig. 5.



Fig. 5 Camera installation

2.3 Device Server

A LANTRONIX UDS2100 device server is installed in the SE and SW locations. The UDS2100 device server allows controlling and managing any piece of equipment with a serial port. This will support the weather station described below. Contact the author of this document for the necessary information to access the NMEA data streams.

2.4 Weather Stations

Airmar LB150WX weather stations have been installed on the SE and SW corners of Building 202. The weather station installed at the SW corner location is shown in Fig. 6. These weather stations provide an NMEA data stream containing the weather parameters. The serial output from these stations is available through the device servers.

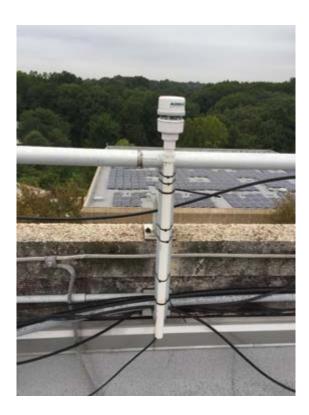


Fig. 6 Weather station

2.5 Ethernet Switches

An 8-port Ethernet switch is installed in the SE and SW locations. The Ethernet switches will allow adding additional equipment that requires a network connection.

2.6 Cable Feed-Through

A cable feed-through was added to facilitate passing cables into the enclosure. This will allow adding additional equipment and capabilities to the sensor network. The feed-through must be sealed to keep water and insects from entering the enclosure.

2.7 Wireless Access Points

Wireless access points have been installed on the NE and SE corners of the building. These provide a network connection to the sensor systems that are on the ALC campus. An Ubiquiti Rocket M900 access point with a high-gain Yagi antenna is installed on the NE corner of the roof (Fig. 7). The SE corner has an Ubiquiti NanoStation LOCO M900 mounted (Fig. 8).



Fig. 7 Ubiquiti Rocket M900 with Yagi antenna on the NE corner of building 204



Fig. 8 Ubiquiti NanoStation Loco M900 on the SE corner of building 202

3. Connection to the ALC Sensor Network

The rooftop systems are connected to the rest of the ALC sensor network through fiber optic cables. The fiber optic cables from each corner of the building lead to a patch panel mounted on one of the "dog houses" on the roof of building 202 (see Fig. 9). The interior view of the patch panel is shown in Fig. 10. For reference, the image has been annotated with the destination of the fiber pairs. From the dog house, the fiber optic cable runs to room 4F025 where media converters perform conversion to Ethernet and finally connect to the rest of the sensor network.



Fig. 9 Fiber optic patch panel



Fig. 10 Interior of fiber patch panel

4. Subscribing to Weather Station Data

Software developers can subscribe to the output of the weather stations through the device servers. Figure 11 contains sample Java source code to capture the NMEA strings from the weather stations. Contact the author for details such as the IP address of the device.

```
package LB150WX:
import java.io.BufferedReader;
import java.io.IOException;
import java.io.InputStreamReader;
import java.net.InetSocketAddress;
import java.net.Socket;
import java.net.SocketAddress;
import java.util.UUID;
public class datareader {
          // TO DO: replace xxx.xxx.xx with the correct IP address
          static String deviceserverIP = "xxx.xxx.xx.xx";
          static int port = 10001;
          public static void main(String[] args) {
                     try {
                                SocketAddress sa = new InetSocketAddress(deviceserverIP,port);
                                Socket sock = new Socket();
                                sock.connect(sa);
                                BufferedReader br = new BufferedReader(new InputStreamReader(sock.getInputStream()));
                                while (true)
                                           String nmeamsg = br.readLine();
                                           // Process the NMEA string here.
                                           System.out.println(nmeamsg);
                                           if (nmeamsg.toUpperCase().contains("$WIMDA"))
                                                      String[] parts = nmeamsg.split(",");
                                                      System.out.println("Temperature="+parts[5]);
                     } catch (IOException e) {
                                e.printStackTrace();
                     }
          }
```

Fig. 11 Java sample code to capture NMEA messages

5. Summary and Conclusions

The improvements to the rooftop sensor system should allow for the installation of additional sensors. Future improvements may include the addition of servers for distributing data from the weather stations to clients. The current device servers allow only 1 connection at a time.

If you need additional information, such as IP addresses and ports, contact the author.

List of Symbols, Abbreviations, and Acronyms

ALC US Army Adelphi Laboratory Center

ARL US Army Research Laboratory

GPS global positioning system

HDTV high-definition television

IP Internet Protocol

NE northeast

NMEA National Marine Electronics Association

NW northwest

SE southeast

SW southwest

1 DEFENSE TECHNICAL

(PDF) INFORMATION CTR DTIC OCA

2 DIR ARL

(PDF) IMAL HRA RECORDS MGMT

RDRL DCL TECH LIB

1 GOVT PRINTG OFC

(PDF) A MALHOTRA

1 DIR ARL

(PDF) RDRL CII B T GREGORY